

BEDFORD 090/065

NH101 over PULPIT BROOK

Monday, March 17, 2014

ASPHALT CRACKED ON
EAST APPROACH AND
NEAR WHITE LINE ON
SOUTH. SRL

D134 35



BEDFORD 090/065

NH101 over PULPIT BROOK

Wednesday, March 14, 2012

RAIL DAMAGE AT
SOUTHWEST END. (STATE
RED LIST)

D085 03



BEDFORD 090/065
NH101 over PULPIT BROOK

Monday, November 21, 2011

NEW CONCRETE
HEADWALL AND NEW RAIL
AT NORTH. (STATE RED
LIST.)

D079 12



Monday, November 21, 2011

PIPE SEPERATION SPAN
#2. (STATE RED LIST.)

D079 13



Monday, November 21, 2011

HEADWALL PUSHING OVER
SPAN #1. (STATE RED LIST.)

D079 14



BEDFORD 090/065
NH101 over PULPIT BROOK

Monday, November 21, 2011

PIPE SEPERATION SPAN
#1. (STATE RED LIST.)

D079 15



Monday, November 21, 2011

ASPHALT PATCH AND NEW
RAIL AT NORTH. (STATE
RED LIST.)

D079 16



BEDFORD 090/065
NH101 over PULPIT BROOK

Thursday, March 03, 2011

NORTH SHOULDER
SETTLED, SEVERAL
CRACKS WITH UP TO 5" IN
WIDTH. (STATE RED LIST.)

D061 14



Thursday, March 03, 2011

CONTINUATION OF
SETTLEMENT ON NORTH
SHOULDER. (STATE RED
LIST.)

D061 15



BEDFORD 090/065
NH101 over PULPIT BROOK

Wednesday, August 04, 2010

ASPHALT CRACKED AND
PATCHED ON NORTH
SHOULDER. (STATE RED
LIST.)

D053 03



Wednesday, August 04, 2010

THREE INCH DEPRESSION
IN ASPHALT AT NORTH
SHOULDER. (STATE RED
LIST.)

D053 04



Wednesday, August 04, 2010

FOUR INCH CRACK IN
ASPHALT AT NORTH
SHOULDER. (STATE RED
LIST.)

D053 05



BEDFORD 090/065
NH101 over PULPIT BROOK

Wednesday, August 04, 2010

ASPHALT CRACKED OVER
SPAN #2. (STATE RED LIST.)

D053 06



Wednesday, August 04, 2010

EROSION & DEPRESSION
BEHIND NORTH
HEADWALL. (STATE RED
LIST.)

D053 07



Wednesday, August 04, 2010

ASPHALT AND RAIL POST
SETTLED ON NORTH SIDE.
(STATE RED LIST.)

D053 08




BEDFORD 090/065
NH101 over PULPIT BROOK

Wednesday, August 04, 2010

3" SEPARATION BETWEEN
SECTION #1 AND #2, SPAN
#1. (STATE RED LIST.)

D053 09

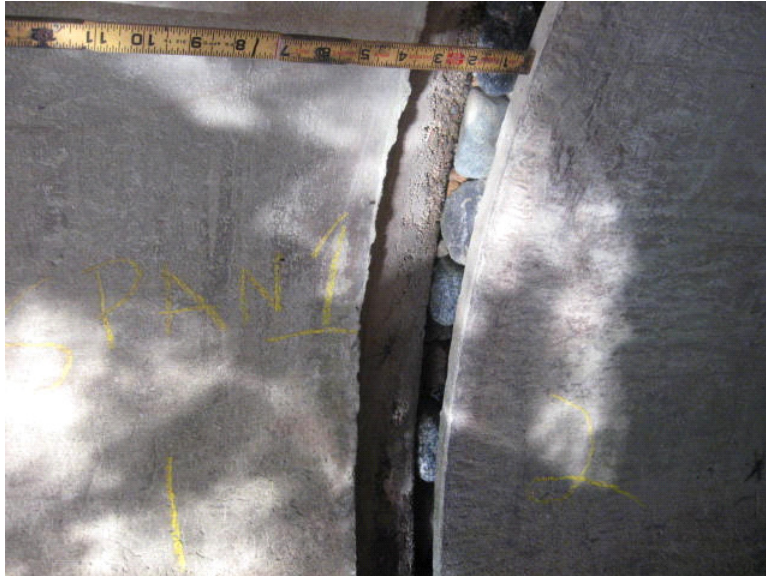

Wednesday, August 04, 2010

3" SEPARATION BETWEEN
SECTION #1 AND #2, SPAN
#1. (STATE RED LIST.)

D053 10



Wednesday, August 04, 2010

BATTER BOARDS IN SPAN
#1. (STATE RED LIST.)

D053 11



BEDFORD 090/065
NH101 over PULPIT BROOK

Wednesday, August 04, 2010

SECTION #15, #16 AND #17
MISALIGNED, SPAN #1.
(STATE RED LIST.)

D053 12



Wednesday, August 04, 2010

3" SEPARATION BETWEEN
SECTION #14 AND #13,
SPAN #1. (STATE RED LIST.)

D053 13



Wednesday, August 04, 2010

2" SEPARATION AND
EXPOSED FILL BETWEEN
SECTION #14 AND #15,
SPAN #1. (STATE RED LIST.)

D053 14



BEDFORD 090/065
NH101 over PULPIT BROOK

Wednesday, August 04, 2010

9" PENETRATION ON ROOF
BETWEEN SECTION #14
AND #15, SPAN #1. (STATE
RED LIST.)

D053 15



Wednesday, August 04, 2010

SECTION #16 AND #17
SEPARATED WITH VOIDS
TO NORTHWEST
HEADWALL, SPAN #1.
(STATE RED LIST.)

D053 16



Wednesday, August 04, 2010

SECTION #16 AND #17
SEPARATED WITH VOIDS
TO NORTHEAST
HEADWALL, SPAN #1.
(STATE RED LIST.)

D053 17



BEDFORD 090/065
NH101 over PULPIT BROOK

Wednesday, August 04, 2010

12" SEPARATION BETWEEN
SECTION #16 AND #17,
SPAN #1. (STATE RED LIST.)

D053 18



Wednesday, August 04, 2010

VOIDS BETWEEN SPAN #1
AND #2 WITH 3' TO 4' OF
PENETRATION. (STATE
RED LIST.)

D053 19



Wednesday, August 04, 2010

VOIDS BETWEEN SPAN #1
AND #2 WITH 3' TO 4' OF
PENETRATION. (STATE
RED LIST.)

D053 20



BEDFORD 090/065
NH101 over PULPIT BROOK

Wednesday, August 04, 2010

SETTLED AND VOIDS IN
NORTH HEADWALL. (STATE
RED LIST.)

D053 21



Wednesday, August 04, 2010

VOID WITH 5' TO 6' OF
PENETRATION IN NORTH
HEADWALL NEAR SPAN #1.
(STATE RED LIST.)

D053 22



Wednesday, August 04, 2010

VOID WITH 5' TO 6' OF
PENETRATION IN NORTH
HEADWALL NEAR SPAN #1.
(STATE RED LIST.)

D053 23



BEDFORD 090/065
NH101 over PULPIT BROOK

Wednesday, August 04, 2010

9" PENETRATION BETWEEN
SECTION #15 AND #16,
SPAN #2. (STATE RED LIST.)

D053 24



Wednesday, August 04, 2010

2' SEPARATION BETWEEN
SECTION #5 AND #6, SPAN
#2. (STATE RED LIST.)

D053 25



BEDFORD 090/065
NH101 over PULPIT BROOK

Monday, March 16, 2009

SPAN #1, OPEN JOINTS AT
NORTH. RED LIST.

D027 46



Monday, March 16, 2009

SPAN #1, OPEN JOINTS AT
NORTH. RED LIST.

D027 47



Monday, March 16, 2009

SPAN #1, OPEN JOINTS AT
NORTH. RED LIST.

D027 48



BEDFORD 090/065
NH101 over PULPIT BROOK

Monday, March 16, 2009

SPAN #1, OPEN JOINTS AT
NORTH. RED LIST.

D027 49



Monday, March 16, 2009

SPAN #2, OPEN JOINTS AT
NORTH. RED LIST.


D027 52



Monday, March 16, 2009

SPAN #2, OPEN JOINTS AT
NORTH. RED LIST.

D027 53

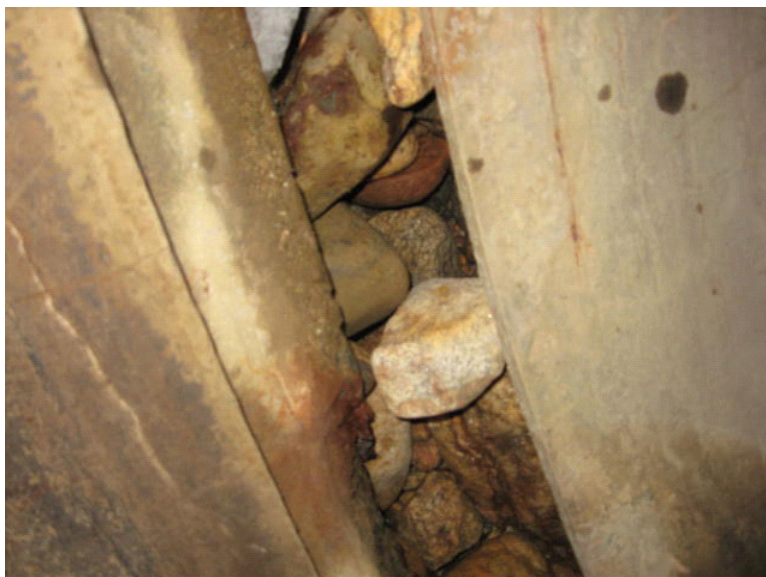

BEDFORD 090/065
NH101 over PULPIT BROOK

Monday, March 16, 2009

BARRELS & HEADWALL
SETTLED AT NORTH. RED
LIST.



D027 54

Monday, March 16, 2009

SPAN #2, OPEN JOINTS AT
SOUTH. RED LIST.



D027 51

Monday, March 16, 2009

ASPHALT CRACKED ON
NORTH SHOULDER;
OPENED TWO INCHES
WIDE, 8" DEEP. RED LIST.



D027 55

BEDFORD 090/065
NH101 over PULPIT BROOK

Monday, March 16, 2009

ASPHALT CRACKED ON
NORTH SHOULDER;
OPENED TWO INCHES
WIDE, 8" DEEP. RED LIST.

D027 56



Monday, March 16, 2009

ASPHALT CRACKED ON
NORTH SHOULDER;
OPENED TWO INCHES
WIDE, 8" DEEP. RED LIST.

D027 57



Monday, March 16, 2009

SOUTHWEST WING
CRACKED, STONES
FALLING. RED LIST.

D027 50

